

# Portable Pressure Calibrator, Wally Box III Model CPH7600

CPH7600 · 06/2013

## Applications

- Calibration service companies and service industry
- Measurement and control laboratories
- Quality assurance

## Special features

- Measurement and automated pressure generation at the touch of a button with integrated pump, -12 to 300 psi (-0.8 ... +20 bar)
- Accuracy: 0.025 % of reading  $\pm 0.01$  % FS (incl. calibration certificate)
- Generation/measurement of 4 ... 20 mA, and 24 V DC
- Voltage supply to power transmitters
- Pressure supply via external compressed air line
- Robust case design, IP 67

## Description

### General information

With the Model CPH7600, Wally Box III, WIKA offers a further development of the well-known Wally Box I and Wally Box II. The Wally Box III is a compact, portable pressure calibrator, that has been designed for mobile use as well as for stationary workshop and laboratory testing. A special feature of this test instrument is that it is fitted with two independently-operating pressure systems.

One pneumatic system is designed to be supplied from an external pressure supply, while the supply pressure of the second system is generated by the integrated electrical pressure pump. This enables the user to perform different measurement tasks or calibrations, regardless of external pressure and power supplies.

### Accuracy

The Wally Box III provides an accuracy of 0.025 % of reading  $\pm 0.01$  % FS for the built-in, isolated pressure sensor. The temperature compensation of the built-in sensor safeguards the accuracy for applications in the field. Readings can be displayed in one of 13 standard units.

Wally Box III model CPH7600



### Features

With the Wally Box III, not only accurate pressure measurements are possible, but also exact current and voltage measurements, as well as a 24 V DC supply to power the device under test. Pressure values and electrical measured values are simultaneously shown in the display. The calibrator is integrated into a robust, as well as dust and watertight transport case. Thus the mobile pressure calibrator is particularly suited to use in harsh industrial environments. A flow diagram on the front panel gives information on the connection of the individual pneumatic components. With the built-in NiMH rechargeable battery, a battery life of 50 hours or 125 pump cycles up to 300 psi is guaranteed. The external universal power supply is designed for an operating voltage of 100 ... 240 V AC.

### Certified accuracy

For each CPH7600 reference pressure sensor, the accuracy is certified by a factory NIST calibration certificate which accompanies the instrument. On request, we can provide a 17025 calibration certificate accredited by A2LA (option).

# Specifications

## Model CPH7600

### Measuring ranges

#### Pressure

Gauge pressure	-12 ... 300 psi (-0.8 ... +20 bar)
Overpressure limit	580 psi (40 bar <sup>1)</sup> )
Burst pressure	1960 psi (135 bar <sup>1)</sup> )
Accuracy	0.025 % of reading $\pm$ 0.01 % FS
Resolution	5-digit
Temperature compensation	15 ... 35 °C
Temperature coefficient	0.002 % of the span/°C beyond the 15 ... 35 °C

#### Current

Measuring range	0 ... 24 mA (max. load 1,000 $\Omega$ )
Resolution	1 $\mu$ A
Accuracy	0.015 % of reading $\pm$ 2 $\mu$ A (simulation and measurement)

#### Voltage

Measuring range	0 ... 30 V DC
Resolution	1 mV
Accuracy	0.015 % of reading $\pm$ 2 mV (measurement)

1) Maximum pressure for the integrated lines: 40 bar

### Base instrument

Pressure supply	maximum pressure for the integrated pressure generation: 300 psi (20 bar) maximum pressure via external pressure supply: 100 psi (7 bar)
Pressure connection	1/8 NPT (female)
Permissible media	clean, dry, non-corrosive gases, compatible with silicon, Pyrex, RTV, gold, ceramic, nickel and aluminium

#### Output

Voltage supply	24 V DC
----------------	---------

#### Power supply

Battery type	16 V DC, NiMH rechargeable battery
Battery life (fully-charged)	approx. 50 hours (only measurement or with external pressure supply) 125 pump cycles to 300 psi (20 bar) 300 pump cycles to 150 psi (10 bar) 1,000 pump cycles to 30 psi (2 bar)

#### Permissible ambient conditions

Operating temperature	-10 ... +50 °C
Storage temperature	-20 ... +60 °C
Relative humidity	35 ... 85 % rh (no condensation)

## Case

### Material

Case	NK-7TM Resin
Front panel	Aluminum
Ingress protection	IP 67 (case closed) IP 40 (case opened)
Dimensions	15.25 x 12 x 7" (387.4 x 304.8 x 177.8 mm)
Weight	15.5 lbs. (approx. 7 kg)

## Approvals and certificates

### CE conformity

EMC directive	2004/108/EC, EN 61326 emission (group 1, class B) and interference immunity (portable equipment)
---------------	--

### Certificate

Calibration	NIST calibration certificate Option: 17025 calibration certificate accredited by A2LA
-------------	--

Further certificates and approvals see local homepage

## Available pressure range and resolution

### Pressure range and factors

	Relative pressure	-12 ... 300 psi (-0.8 ... +20 bar)
	Overpressure limit	580 psi (40 bar)
	Burst pressure	1960 psi (135 bar)
Unit	Pressure range	
psi	1	300.00
bar	0.06894757	20.684
mbar	68.94757	20,684
kPa	6.894757	2,068.4
MPa	0.00689476	2.0684
kg/cm <sup>2</sup>	0.07030697	21.092
cmH <sub>2</sub> O (4 °C)	70.3089	21,093
cmH <sub>2</sub> O (20 °C)	70.4336	21,130
inH <sub>2</sub> O (4 °C)	27.68067	8,304.2
inH <sub>2</sub> O (20 °C)	27.72977	8,318.9
inH <sub>2</sub> O (60 °F)	27.70759	8,312.3
mmHg (0 °C)	51.71508	15,515
inHg (0 °C)	2.03602	610.81

## Features

### Pressure supply

The Wally Box III enables the supply of pressure in two different ways. The first is an integrated electric pump from -12 ... 300 psi (-0.8 ... +20 bar). The second is the connection of compressed air up to 115 psi (8 bar), which allows the user to control pressures up to 7 bar via a fine adjustment.

The advantage for the user of these two different pressure supplies is that the compressed air supply of a workshop can be used, but also, for applications in the field, the air supply is provided via the integrated electrical pressure pump.

### Current and voltage

In addition to pressure, the Wally Box III measures and simulates a 4 ... 20 mA current loop signal, can measure up to 30 V DC and comes with an internal 24 V DC voltage supply to power the transmitter being calibrated. The 24 V DC voltage supply is switchable for transmitters with mA as well as V output signal.

### Display

The Wally Box III can display up to three calibration values simultaneously. This means that the internal pressure sensor, an external pressure sensor and electrical values (mA or V) can be displayed simultaneously. The instrument has a large graphic LCD display with backlighting.

### Pressure ranges

The Wally Box III features an integrated reference pressure sensor with a measuring range of -12 ... 300 psi (-0.8 ... +20 bar). Since the accuracy is specified in % of reading, the Wally Box III lends itself to the calibration of test items with different measuring ranges up to 300 psi (20 bar).

Each pressure range can be accurately generated with the integrated electric pump at the touch of a button, or accurately controlled with external compressed air. The fine adjustment is made with the integrated volume control.

### Functions


The Wally Box III has a complete range of useful functions. Switch tests can be performed via the internal or external pressure input. The deviation of the test item is directly calculated and indicated on the display. A damping function is available. Up to five frequently-used instrument settings can be stored and retrieved with the touch of a key.

Additionally, high-accuracy model CPT6100 external pressure sensors can be connected via a sensor cable. This allows accuracies of up to 0.01 % to be achieved.

### Robustness

The Wally Box III consists of a calibrator, which is built into a rugged service case. With this design, the Wally Box III is suited to extremely harsh operating conditions.

## Display layout

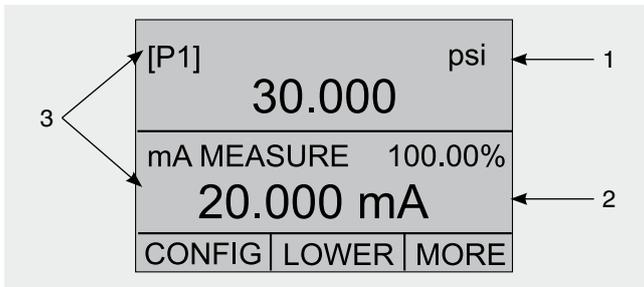

### 1) Pressure units

Indication of the pressure unit (selectable from 13 pressure units)


### 2) Display of the span

Indication of 4 ... 20 mA span (only for the functions mA and mA current loop)

### 3) Primary parameters

Indication of the current measured parameters

## Keypad

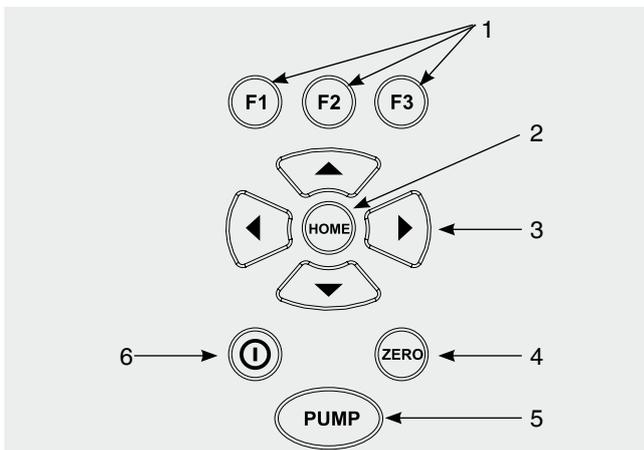

### 1) Function keys

Configuration of the calibrator

### 2) HOME key

Return to main menu

### 3) Arrow keys

Control of the current source/current simulation and adjustment of the pump limit and the %-error limit

### 4) ZERO key

Zeroing of the pressure measurement


### 5) PUMP key

Start-up of the pump operating

### 6) ON/OFF key

Turning the calibrator on and off

Dimensions in inches (mm)

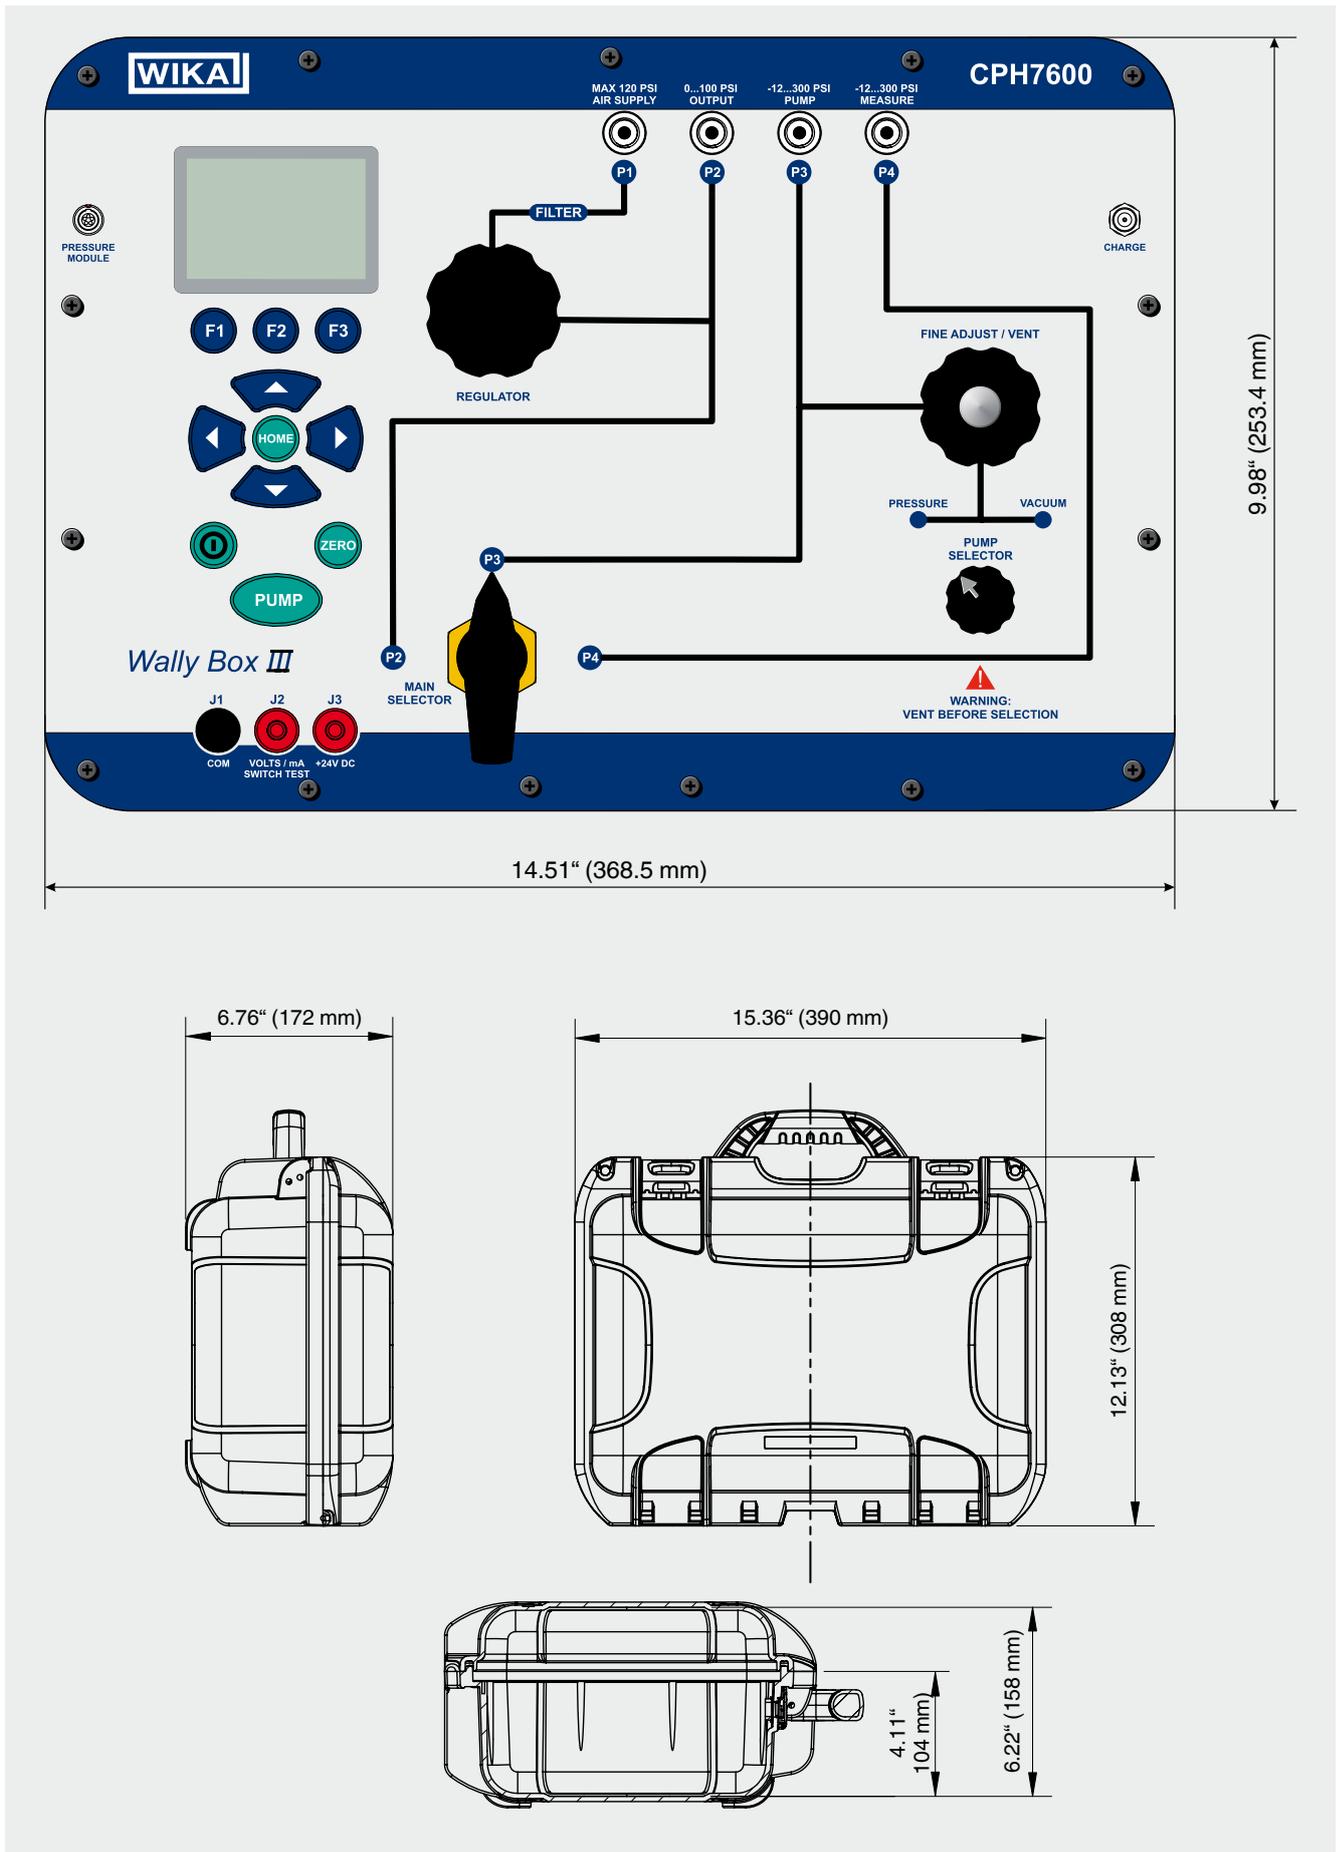


## Special operating modes

### Operating mode: Pressure switch test

#### Pressure switch test

With the pressure switch function, the Wally Box III can indicate the pressures at which the switch closes or opens. In addition, the hysteresis can be calculated.

In the switch test mode the display update rate is increased to capture changing pressure inputs quickly.

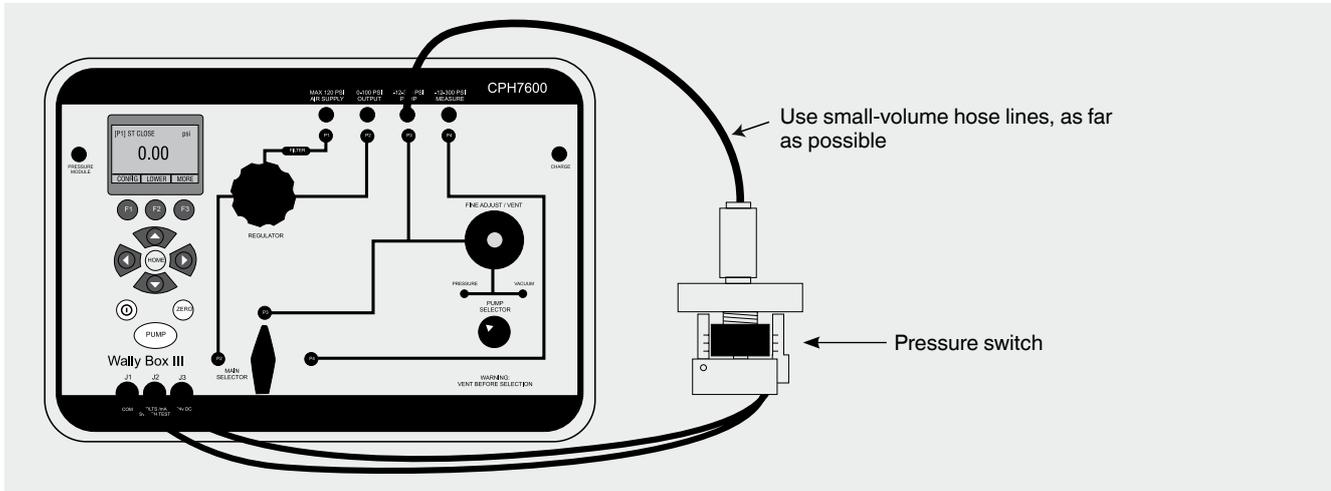

### Operating mode: Calibrating transmitters and %-error function

#### Calibrating transmitters

With the mA/V measuring function, 4 ... 20 mA output and 0 ... 30 V output can be read from the test item. This can be done in two ways.


- 1) **Passive** – the test item generates 4 ... 20 mA or 0 ... 30 V directly. The value is read by the calibrator.
- 2) **Active** – the calibrator supplies a voltage of 24 V DC to the test item while reading the resulting 4 ... 20 mA or 0 ... 30 V signal.

The calibrator features a special function which can calculate the error in the pressure value from the mA value as a percentage of the 4 ... 20 mA span. The %-error mode uses

all three screens and has a special menu structure. It displays pressure, mA and %-error simultaneously.

#### Example:

A transmitter to be tested has a measuring range of 20 bar and outputs a corresponding 4 ... 20 mA signal. The user can program in a 0 ... 20 bar pressure span into the calibrator and the calibrator will then calculate and display the deviation or error in a percentage value of the 4 ... 20 mA output. This is produced without the need for any manual calculation, which is also an advantage if it is difficult to set an accurate pressure using an external pump.

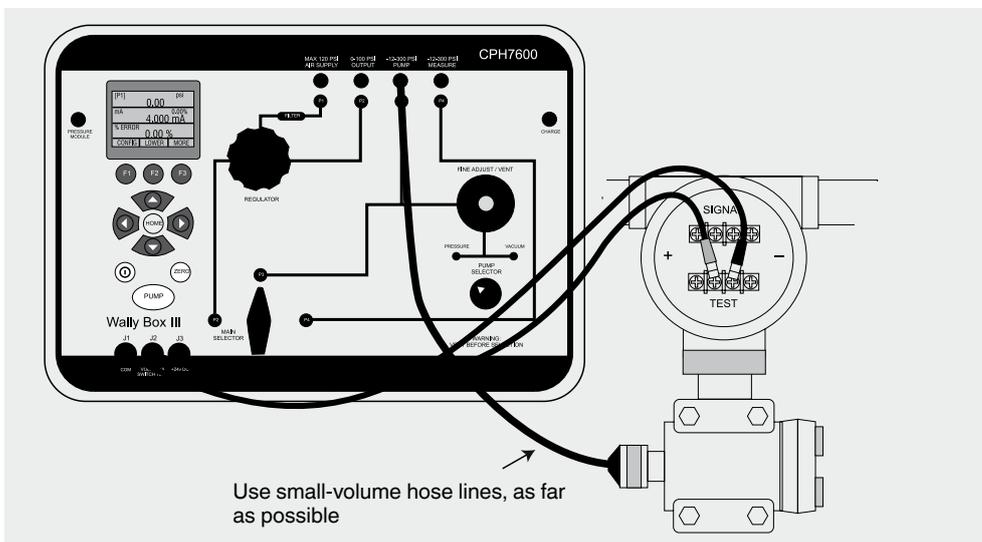

## Dirt trap

The Wally Box III should only be used with dry and clean test items. Soiling of the integrated pump, for example, through contaminated test items, can lead to faults on the pump or require the pump to be cleaned.

By using the dirt trap specifically developed for the Wally Box III, contamination of the integrated pump can be prevented.

## Using the dirt trap

The dirt trap is attached, hand-tight, at the pressure connection of the calibrator. Sealing is achieved via the O-ring fitted on the 1/8 NPT male thread of the dirt trap. The maximum working pressure is limited to 35 bar.

The test item is mounted to the upper connection of the dirt trap, using a suitable sealing method. The connection to the test item is usable universally as 1/8 NPT female or 1/8 BSP female. Use a 7/8" or 23 mm wrench on the hex of the upper pressure port to connect the test item with the dirt trap.

As soon as either moisture or dirt can be seen in the transparent chamber, the dirt trap should be removed and cleaned.



Once the upper dirt trap connection has been unscrewed, the transparent acrylic chamber and the O-rings can be removed and cleaned with a clean cloth.



Wally Box III, model CPH7600 with mounted dirt trap



Dirt trap

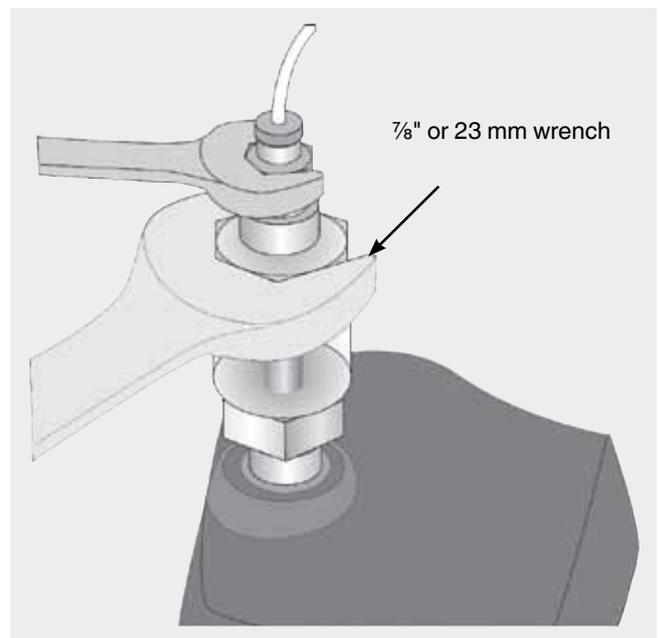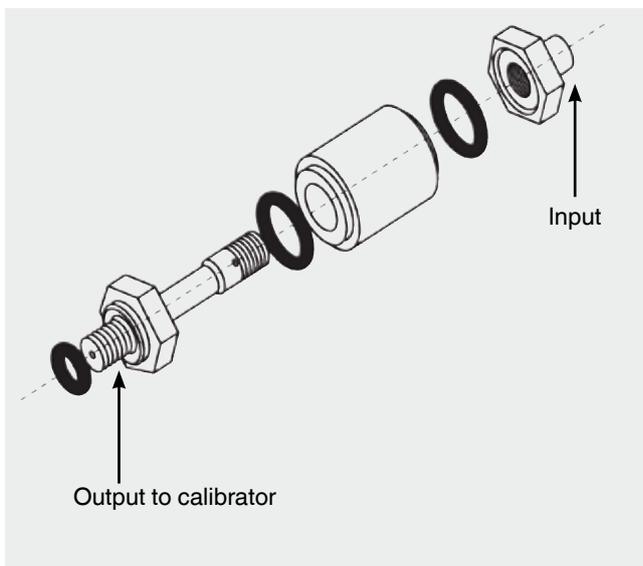

## Scope of delivery

- Wally Box III model CPH7600
- Operating instructions
- Test cables
- Calibration hose with 1/8 NPT male thread connections
- Adapter set consisting of:
  - 1/8 NPT female to 1/4 NPT female
  - 1/8 NPT female to 1/4 BSP female
  - 1/8 NPT female to G 1/2 female
- PTFE thread seal tape
- Battery charger
- NIST calibration certificate

## Accessories

- Dirt trap
- FasTest fitting

## Option

- 17025 calibration certificate accredited by A2LA

## Ordering information

To order the described product the given order number is sufficient. Other options require additional specification.

© 2012 WIKA Alexander Wiegand SE & Co. KG, all rights reserved.  
The specifications given in this document represent the state of engineering at the time of publishing.  
We reserve the right to make modifications to the specifications and materials.



**Mensor Corporation**  
201 Barnes Drive  
Tel. (512) 396-4200  
Fax (512) 396-1820  
E-mail [sales@mensor.com](mailto:sales@mensor.com)  
[www.mensor.com](http://www.mensor.com)